General Warranty

We warrant that the product will be free from defects in materials and workmanship for a period of 3 years from the date of purchase of the product by the original purchaser from our company. The warranty period for accessories is 12 months. This warranty only applies to the original purchaser and is not transferable to a third party.

If the product proves defective during the warranty period, we will either repair the defective product without charge for parts and labour, or will provide a replacement in exchange for the defective product. Parts, modules and replacement products used by our company for warranty work may be new or reconditioned like new. All replaced parts, modules and products become the property of our company.

To obtain service under this warranty, the customer must notify our company of the defect before the expiration of the warranty period. Customer shall be responsible for packaging and shipping the defective product to the designated service centre, a copy of the customer's proof of purchase is also required.

This warranty shall not apply to any defect, failure or damage caused by improper use or improper or inadequate maintenance and care. We shall not be obligated to furnish service under this warranty a) to repair damage resulting from attempts by personnel other than our company representatives to install, repair or service the product; b) to repair damage resulting from improper use or connection to incompatible equipment; c) to repair any damage or malfunction caused by the use of not our supplies; or d) to service a product that has been modified or integrated with other products when the effect of such modification or integration increases the time or difficulty of servicing the product.

Please contact the nearest Sales and Service Offices for services.

Excepting the after-sales services provided in this summary or the applicable warranty statements, we will not offer any guarantee for maintenance definitely declared or hinted, including but not limited to the implied guarantee for marketability and special-purpose acceptability. We should not take any responsibilities for any indirect, special or consequent damages.

Table of Contents

1. General Safety Requirements	1
2. Safety Terms and Symbols	3
3. User Notice	4
3.1 General Inspection	4
3.2 Safety Precaution before Operation 3.2.1 Check Power Supply 3.2.2 Allowed Variation Range of Supply Power Parameters 3.2.3 Power Cord Selection 3.2.4 Electro-static Discharge (ESD) Protection	4 .5 .5
3.3 First Time to Power on	6
3.4 Front Panel 3.4.1 Front Panel Function Key3.4.2 Parameter Input13.4.3 Front Panel Connector	8 1
3.5 Rear Panel1	
3.6 User Interface1	5
3.7 Build-in Help1	7
3.8 Basic Measurement1	8
4. Troubleshooting2	1
5. Appendix2	2
Appendix A: Enclosure2	2
Appendix B: General Care and Cleaning2	3
Appendix C: USB Disk Requirements2	3
Appendix D: PC Software Requirements2	3

1. General Safety Requirements

Before use, please read the following safety precautions to avoid any possible bodily injury and to prevent this product or any other connected products from damage. To avoid any contingent danger, ensure this product is only used within the ranges specified.

- Use Proper Power Cord. Use only the power cord supplied with the product and certified to use in your country.
- Product Grounded. This instrument is grounded through the power cord grounding conductor. To avoid electric shock, the grounding conductor must be grounded. The product must be grounded properly before any connection with its input or output terminals.
- Check all Terminal Ratings. To avoid fire or shock hazard, check all ratings and markings on this product. Refer to the user manual for more information about ratings before connecting to the instrument.
- Use Proper Overvoltage Protection. Make sure that no overvoltage (such as that caused by a thunderstorm) can reach the product, or else the operator might expose to danger of electrical shock.
- Do not operate without covers. Do not operate the instrument with covers or panels removed.
- Avoid exposed circuit. Be careful when working on exposed circuitry to avoid risk of electric shock or other injury.
- Do not operate if any damage. If you suspect damage to the instrument, have it inspected by qualified service personnel before further use. Any maintenance, adjustment or replacement especially to circuits or accessories must be performed by qualified service personnel.
- Use your Oscilloscope in a well-ventilated area. Make sure the instrument installed with proper ventilation.
- Do not operate in damp conditions. In order to avoid short circuiting to the interior of the device or electric shock, please do not operate in a humid environment.

- Do not operate in an explosive atmosphere. In order to avoid damages to the device or personal injuries, it is important to operate the device away from an explosive atmosphere.
- Keep product surfaces clean and dry. To avoid the influence of dust or moisture in air, please keep the surface of device clean and dry.
- Electrostatic Prevention. Operate the instrument in an electrostatic discharge protective environment to avoid damage induced by static discharges. Always ground both the internal and external conductors of cables to release static before making connections.
- Protect the Input Terminals of Instrument. Do not bend or hit the input terminals and the connected devices, (such as filter, attenuator, etc.) as such stress may cause damages to devices and the instrument. Do not mix the use of 50Ω and 75Ω connectors and/or cables.
- Do Not Overload the Input. To avoid damaging the instrument, the signals at input terminal must be less than 50V DC voltage components and 30 dBm (1 W) AC (RF) components.
- Appropriate Use of Power Meter. If you are not sure of the characteristics of signal under measure, follow these recommendations to ensure safe operations: if a RF power meter is available, use it to measure the power level of this signal first; or add a rated external attenuator between signal cable and input terminal of the instrument. Maximum attenuation, reference level and maximum span frequency should be selected, so as to make the signals displayed within the screen.
- Know About the Specification Conditions of the Instrument. For maximum performance of the instrument, use the analyzer under specified conditions.
- Handling Safety. Please handle with care during transportation to avoid damages to buttons, knob, interfaces and other parts on the panels.

2. Safety Terms and Symbols

Safety Terms

Terms in this manual (The following terms may appear in this manual):

- ! Warning indicates conditions or practices that could result in injury or loss of life.
- CAUTION
- ! Caution indicates the conditions or practices that could result in damage to this product or other property.

Terms on the product (The following terms may appear on this product):

DANGER Indicates an immediate hazard or injury possibility.
 WARNING Indicates a possible hazard or injury.
 CAUTION Indicates potential damage to the instrument or other property.

Safety Symbols

Symbols on the product (The following symbols may appear on the product):



Hazardous Voltage

Chassis Ground

Refer to Manual

3. User Notice

This chapter states the matters need to attention before first power on, and how to power on at first time, introduces spectrum analyzer's front/rear panel and user interface, explains how to use the instrument with a measurement example demonstration.

3.1 General Inspection

When you receive your new instrument, it is recommended that you check the instrument following these steps:

1. Check for transportation damage.

If it is found that the packaging carton or the foamed plastic protection cushion has suffered serious damage, do not throw it away until the complete device and its accessories have been electrically and mechanically checked.

2. Check the Accessories

The supplied accessories are described in the "Appendix A: Enclosure" of this Manual. Please ensure that all the listed accessories are present and undamaged, if any problems are found please contact your distributor or our local office.

3. Check the Complete Instrument

If there is any physical damage, operational fault, or performance issue please contact your distributor or our local office. If there is any damage to the instrument please ensure you keep the original packaging. Ideally you should always keep the original packaging if the instrument must be returned for repair.

3.2 Safety Precaution before Operation

3.2.1 Check Power Supply

The analyzer is equipped with a three-wire power cord in accordance with international safety standards. The product must be grounded properly before being powered on, as floating or improper ground may cause damage to the instrument or personal injury.

Make sure the grounding conductor of the spectrum analyzer is grounded before turning on the instrument. After which the AC power cord can be connected. Do not use a non-ground power

cord.

3.2.2 Allowed Variation Range of Supply Power Parameters

The spectrum analyzer is compatible with 100V~240V, 50Hz-60Hz AC power, Table 3 -1 lists the power requirement to run the spectrum analyzer.

 Table 3-1 Working Power Variation Range

Power Supply Parameter	Compatible Range
Voltage	100 - 240 VAC
Frequency	50 - 60 Hz ±10%
Power	22 W

To prevent or lower the risk of damage to the spectrum analyzer from power interference between instruments, especially from peak pulses produced by large power consumption instruments, a 220V/110V AC regulated power supply is recommended.

3.2.3 Power Cord Selection

The analyzer is equipped with a three-wire power cord in accordance with international safety standards. This cable grounds the analyzer cabinet when connected to an appropriate power line outlet. The cable must be rated greater than 250Vac and 2A.

WARNING

Improper grounding may cause damage to the instrument, or result in personal injury. Make sure the grounding conductor of the spectrum analyzer is grounded before turning on the instrument.

Always use a well-grounded power source. Do not use an external power cable, power cord or an auto transformer without grounded protection. If this product is to be powered via an external auto transformer for voltage reduction, ensure that its common terminal is connected to a neutral (earthed pole) of the power supply.

WARNING

! Make sure the supply power is stable before turning on the analyzer to protect it from damage. Refer to "First Time to Power on" section 3.

3.2.4 Electro-static Discharge (ESD) Protection

ESD is an issue often ignored by users. Damage from ESD on the instrument is unlikely to occur immediately but will significantly reduce the reliability of it. Therefore, ESD precautions should be implemented in the work environment, and applied daily.

Generally, there are two steps to manage ESD protection;

1) Conductive table mats to connect hands via wrist bands

2) Conductive ground mat to connect feet via ankle straps

Implement both protection methods will provide a good level of anti-static protection. If used alone, the protection will not be as reliable. To ensure user's safety, anti-static components should offer at least $1M\Omega$ isolation resistance.

WARNING

! The above ESD protections measures cannot be used when working with over 500V!

Make good use of anti-static technology to protect components from damage:

1) Quickly ground the internal and external conductor of the coaxial cable before it is connected with the spectrum analyzer.

2) Staff must wear anti-static gloves before touching the connector cord or doing any assemble work.

3) Assure all the instruments are grounded properly to avoid static storage.

3.3 First Time to Power on

Connect the three-pin AC power cord into the instrument. Insert the plug into a power socket provided with a protective ground.

WARNING

- ! Check the power source before turning on the spectrum analyzer, to protect the device from damage.
- 1) Press the power switch (b) on the bottom left of the front panel.
- 2) Self-initialization takes about 30 seconds, after the boot screen the spectrum analyzer will default to the scanning curve.
- 3) After power on, let the spectrum analyzer warm up for 30 minutes for stabilization to obtain the most accurate results.

3.4 Front Panel


Figure 3-1 Front panel



NO. Description NO. Description	
---------------------------------	--

%	LCD	ſ	Numeric keypad
]	Menu softkeys	\rightarrow	Tracking generator output connector
;	Function keys	0	Earphone interface
\downarrow	Knob	10	USB Host port
5	Arrow keys	%	Power key (Push to turn on, long push to turn off)
6	RF Input connector		Cer 1

3.4.1 Front Panel Function Key

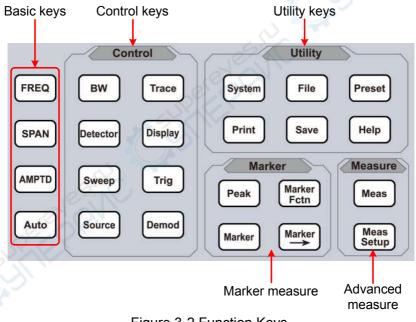



Keys	Description
Basic keys	

	FREQ	Activates the center-frequency function, and accesses the frequency function menu.	
	SPAN	Activates the frequency sweep span function, and set Full Span\Zero Span\Last Span.	
	AMPTD	Activates the reference level function, and accesses the amplitude softkeys, with which you set functions that affect data on the vertical axis.	5.20
	AUTO	Searches the signal automatically within the full frequency range.	Sn.
	Control keys	- 9° (V	
	BW	Activates the RBW (resolution bandwidth) function, and accesses the softkeys that control the bandwidth functions and averaging.	
	Trace	Accesses the softkeys that allow you to store and manipulate trace information.	
	Detecto	Accesses the softkeys that allow you to configure detector functions.	
	Display	Accesses the softkeys that allow you to control what is displayed on the analyzer, including the display line, graticule and label.	
2 5 SV	Sweep	Accesses the softkeys that allow you to set the sweep time, select the sweep mode of the analyzer.	
\bigcirc	Trig	Accesses the softkeys that allow you to select the trigger mode of the analyzer.	
	TG	Accesses the softkeys that allow you to set the tracking generator.	
	Demod	Accesses the softkeys that allow you to set the demodulation.	
	Marker measu	re keys	

	1	-
Peak	Places a marker on the highest peak, and accesses the Peak functions menu.	
Marker	Accesses the marker control keys that select the type and number of markers and turns them on and off.	
Marker	Accesses the marker function softkeys that allow you to set other system parameters based on the current marker value.	s.P.C.
Marker Fctn	Accesses the menu of special functions, such as marker noise, N dB bandwidth measure and frequency counting.	2m
Advanced mea	asure keys	
Meas	Accesses the softkeys that let you make transmitter power measurements such as ACPR(adjacent channel power), channel power, and OBW(occupied bandwidth), etc.	
Meas Setup	Sets the parameters for the selected measurement function.	
Utility keys	O'LX	1
System	Sets the system parameters, and accesses the calibration menu.	
File	Accesses the softkeys that allow you to configure the file system of the analyzer.	
Preset	Resets the analyzer to the factory settings, user state or Last off state. This state can be specified in 【System】→ [PowerOn/Preset►]→[Preset►].	
Quick Save	Quickly save screenshots, trace data, and user status	
Save/ Recall	Save/recall screenshots, trace data, user status	
	Marker Marker Fctn Advanced mea Meas Meas Setup Utility keys System File Preset Quick Save	Yeak accesses the Peak functions menu. Marker Accesses the marker control keys that select the type and number of markers and turns them on and off. Marker Accesses the marker function softkeys that allow you to set other system parameters based on the current marker value. Marker Accesses the menu of special functions, such as marker noise, N dB bandwidth measure and frequency counting. Advanced measure keys Accesses the softkeys that let you make transmitter power measurements such as ACPR(adjacent channel power), channel power, and OBW(occupied bandwidth), etc. Meas Sets the parameters for the selected measurement function. Utility keys Sets the system parameters, and accesses the calibration menu. File Accesses the softkeys that allow you to configure the file system of the analyzer. Preset Resets the analyzer to the factory settings, user state or Last off state. This state can be specified in [System] → [PowerOn/Preset▶]. Quick Quickly save screenshots, trace data, and user status Save/ Save/recall screenshots, trace data, user

Press the Help key to activate the help system. Press the Help key again to exit.

3.4.2 Parameter Input

Specific parameter values are able to be entered using the numeric keypad, knob, and directional keys.

Numeric Keypad



Figure 3-3 Numeric Keypad

1. Numeric keys

Numbers 0-9 are available to be used.

2. 🕟 Decimal point

A decimal point "." will be inserted at the cursor position when this key is pressed.

3. +-- Sign key

Sign key "+/-" is to toggle the sign of a parameter. When pressed the first time, a "-" will be inserted and changed into "+" following the second press.

- 4. 💌 Cancel Key
 - (1) During the editing process this key will clear the inputs in the active area and exit editing mode at the same time.
 - (2) Turn off the display in the active area.
 - (3) Exit current test mode while in keyboard test.
- 5. 🗲 Back Key
 - (1) During the process of parameter editing, this key will delete the characters on the left side of the cursor.
 - (2) While in the process of file name editing, pressing this key will delete characters that have been entered.
- 6. Enter

When pressed, the system will complete the input process and insert a default measurement unit for the parameter automatically.

Knob



Figure 3-4 The knob

The knob function:

During parameter editing, turn the knob clockwise to increase, or counterclockwise to decrease the parameter values at specified steps.

Direction key



Figure 3-5 Direction keys

The directional keys have following functions:

- 1) Increase or decrease the parameter value at specific steps while editing a parameter.
- Move the cursor though the directory tree in the [File] function.
- 3.4.3 Front Panel Connector
- 1. USB Host



The analyzer may serve as a "host" device to connect to external USB devices. This interface is available for USB storage devices.

2. GEN Output 50 Ω (tracking generator output 50 Ω)



The output of the tracking generator can be connected to a receiver through an N type male connector, users can purchase this option if required.

- CAUTION
- ! Input voltage at RF input port must not be higher than 50 V DC to avoid damage to the attenuator and input mixer tracking generator.

3. RF Input 50Ω

The RF input may be connected to a device via a N type connector

CAUTION

! When input attenuator is higher than 10 dB, the RF port input signal must be less than +30 dBm.

3.5 Rear Panel



Figure 3-6 Rear Panel

Table 3-4	Rear Panel De	scription
-----------	---------------	-----------

NO.	Name	Description
1	Handle	Stow the handle for mobile use.

		1	
2		You can lock the spectrum analyzer to a	
	Lock hole	fixed location using the security lock (please buy it yourself) to secure the	
		spectrum analyzer.	
3	HDMI interface	HDMI output, connect an external monitor	
4	USB Device interface	or projector. This configurable USB port permits external USB devices. It supports PictBridge printer and remote-control connection.	
5	External trigger connector	Connect an external TTL signal.	
6	10MHz IN/OUT	The BNC input or output of the 10 MHz reference clock	
7	LAN interface	Through this interface, the analyzer can be connected to your local network for remote control.	
8	Stool	To adjust the angle of the device	
9	AC power connector	AC: frequency 50Hz±10%, single-phase alternative 220V±15% or 110V±15%	

3.6 User Interface

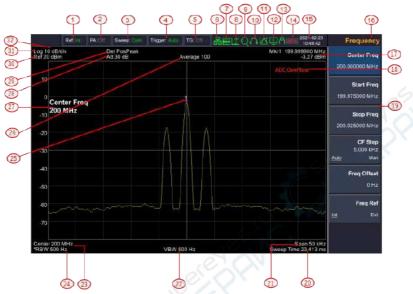


Figure 3-7 User interface

 Table 3-5
 User interface Description

ſ	NO.	Name	Description	Related Key	
	1	Reference frequency	Set the reference frequency as Int (internal) or Ext (external) input	FREQ → [Freq Ref]	
	2	Preamplifier	Turn on/off the preamplifier	AMPTD→ [Preamplifier]	
9	3	Sweep status	Set the sweep status to Single or Cont (continuous)	【Sweep】→ [Sweep Single] or [Sweep Cont]	
	4	Trigger type	Set the trigger type to Auto, Video, Pos (external positive edge), Neg (external negative edge)	【Trig】	

5	Tracking generator	Show the source type as CW (Continuous Wave) or TG (Tracking Generator), press to turn on/off the source output	【TG】 → [Source GEN]	
6	LAN access sign	LAN access sign		
7	Analog demodulation	Turn on analog demodulation	【Demod】 → [A nalog Demod]	
8	FFT mode	When RBW is set to less than 3kHz, automatically switch to FFT mode	- COAN	
9	Automatic mode	Turn on automatic mode	[Auto]	
10	Audio demodulation	Turn on audio demodulation	$[Demod] \rightarrow [Demod]$	
%	Peak search	Turn on peak search	【Peak】→ [Cont Max]	
ľ	Remote control	Turn on remote control		
]	USB storage device	Show if USB storage device is inserted;		
\rightarrow	UNCAL sign	Measurement is not calibrated		
;	Date/time	Display system date and time	【System】 → [Date/Time]	
•	Menu title	Function of current menu belongs to.		
Ļ	Marker readout	Display frequency and amplitude of current marker	[Marker]	
10	Overflow sign	When the input signal exceeds the ADC range, this sign will appear		
5	Menu item	Menu item of current function		
6	Sweep Time	System sweep time	【Sweep】 → [Sweep Time]	

%	Span	Display span width	【SPAN】→[Spa n] or 【FREQ】→[Sto p Freq]	
ľ	Video bandwidth	Display video bandwidth	[BW] → [VBW]	
]	Center frequency	Display center frequency	【FREQ】→ [Center Freq] or [Start Freq]	
\rightarrow	Resolution bandwidth	Display resolution bandwidth	【BW】→[RBW]	
;	Marker	Display current activated marker	[Marker]	
0	Trace average number	Continuously get average of the trace to smooth it.	BW → [Average]	
→	Active parameter setting	Use the number keypad, knob, and arrow keys to set the value.		
10	Attenuation	Display input attenuation setting	AMPTD → [Attenuation]	
(5)	Detector type	Display detector type	[Detector]	
6	Reference level	Reference level	AMPTD → [Ref Level]	
31	Amplitude Scale Type	Log (logarithmic) or Line (linear)	AMPTD → [Scale Type]	
32	Amplitude Scale	Display amplitude scale	AMPTD → [Scale/Div]	

3.7 Build-in Help

The built-in help provides information that refers to every function key and menu key on the front panel. Users can view this help information if required.

1. How to acquire built-in help

Press Help; a prompt about how to obtain help information will be shown

2. Page up and down

If there is more than one page of information, you can read the complete information by using the directional keys.

3. Close the current help information Press "Help" again to close help.

4. Acquire the menu help

A message about how to obtain help information will be shown, press the menu keys to get the corresponding help.

5. Acquire the help information of any function key A message about how to obtain help information will be shown, press any function key to get the corresponding help.

3.8 Basic Measurement

Basic measurements include, input signal frequency and amplitude display, marked by a frequency marker. Follow these four simple steps below to implement input signal measurement. Basic:

- 1. Setting center frequency;
- 2. Setting span and resolution bandwidth;
- 3. Activate marker;
- 4. Setting amplitude;

For example, to measure a 100MHz -20dBM signal, you must turn on the spectrum analyzer and ensure it is warmed up for 30 minutes to ensure measurement accuracy.

1. Equipment connection:

Connect the output terminal of signal generator to the **RF Input 50** Ω terminal of spectrum analyzer. Set the parameters as follows:

Frequency	100 MHz
Amplitude	-20 dBm

- 2. Setting parameters:
- 1) Press [Preset] to restore the analyzer to its factory-defined state. The Spectrum analyzer will display the spectrum from 9kHz to the maximum span width. The signal generated will display as a vertical line at 100MHz. Refer to Figure 3-8°

	Refamil PAcon	Sweep: Cont	Trigger: Auto	TG: Off		2021-02-05 12:25:16	Frequency
g 10 dB/ f0 dBm	'div	Det PosPeak Att 10 dB					Center Free 750.009000 MH
20 Cei	nter Freg						Start Free 9.000 kH
30 30 40	0.009 MHz						Stop Fre 1.500009000 GH
50						ed as any property and an	CF Ste 150.000000 MH Auto Ma
50 / 141 4 70	anga ang ang ang ang ang ang ang ang ang	- <i>640-648.6490-9</i> -7-19	www.zelany	19-14-2-14-2-14	Weldon and a	yladerskovskovekovek	Freq Offs 0 H
30							Freq Re
90	009 MHz					Span 1.5 GH	

Figure 3-8 Full Span

To clearly observe the signal, reduce the frequency span to 1 MHz and set the center frequency to 100MHz.

2) Setting Center Frequency

Press "FREQ", select [Center frequency] on corresponding pop up menu. Input "100" and select the unit as MHz on the numeric keypad. The keys can be used to set the exact value but the knob and directional keys can also be used to set the center frequency. 3) Setting Frequency Span

Press [SPAN], input "1" and select **MHz** as its unit using the numeric keypad; or press [\downarrow] to decrease to 1MHz.

Press **[BW]**, set [resolution bandwidth] to manual, and input **"30**" and select **kHz** as its unit using the numeric keypad; or

press $[\downarrow]$ to decrease to 30kHz.

Press [Detector], set the detection type to positive peak. Figure 3 -9 shows the signal at a higher resolution.

Please note that resolution bandwidth, video bandwidth and frequency span are self-adapted. They adjust to certain values according to frequency span. Sweep time can be self-adapted too.

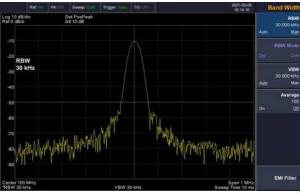


Figure 3-9 Set frequency span

4) Activate Marker

—Press [Marker] button in the function area. Press the softkey to select [Marker $\underline{1} 2 3 4 5$], select Marker 1, the marker is located at horizontal center by default, that is the signal peak point or its neighbor.

—Press Peak, and enter the next level menu, select [Max Search]. Frequency and amplitude values are read by the marker and shown on the top right of the display area.

5) Setting amplitude

The reference level will be shown at the top of the display grid. To get a better dynamic range, the real signal peak point should be located at or near the top of display grid (reference level). The reference level is also the maximum value on Y axis. Here we reduce to 10dB reference level to increase the dynamic range.

Press [AMPTD], the amplitude setting menu will pop up, and the [reference level] soft key will be activated. The reference level can be input at the top left of the display grid. Input "-10" using the numeric keypad and set the unit to dBm. You can also use the

 \downarrow key or the knob for adjustment.

The reference level is set at -10dBM, which is the signal peak value near the top of the grid. The balance between the signal peak value and noise is dynamic range.

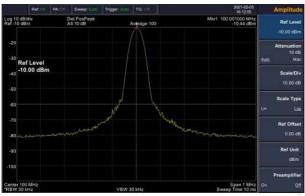


Figure 3-10 Set reference level

4. Troubleshooting

Typical issues that may occur when using your spectrum analyzer:

- Power on malfunction
- No signal display
- Wrong measurement results or poor frequency or amplitude precision.

1. Power on malfunction

Power on malfunction can include a situation where the screen is still dark (no display) after switch on.

If the screen is still dark after power on, please check:

1) If the power supply has been connected correctly and it the power supply voltage range is within the specification.

- 2) If the power switch has been turned on.
- 3) If the fan is running, please contact us for service.

2. No signal display

If there is no signal display at any wave band. Please try the following: set a signal generator at 30 MHz frequency and -20 dBm power and connect it to the spectrum analyzer RF input connector. If there is still no signal display, there may be a problem with the spectrum analyzer hardware circuit. Please contact us for service.

3. Wrong measurement results or poor signal frequency precision

If the display contents shake a lot or the frequency readout

exceeds the error range during measurements, check if the signal source is stable. If so, check if spectrum analyzer reference is precise. Select internal or external frequency reference according to measurement conditions: press [FREQ] →[frequency reference Internal External]. If the frequency is still not precise, then the spectrum analyzer LO has lost its phase lock, please contact us for service.

4. Wrong measurement results or poor readout amplitude precision

If signal amplitude readout is not precise, perform a calibration. If amplitude readout is still not precise, then it may be a problem with internal circuit, please contact us for service.

5. Appendix

Appendix A: Enclosure

(The accessories subject to final delivery.) Standard Accessories





N-SMA Adaptor

Near Field Probe includes: Four near-field probes, N-SMA adapter, SMA-SMA cable (Frequency range: 30 MHz – 3 GHz)

Appendix B: General Care and Cleaning

General Care

Do not store or leave the instrument where the liquid crystal display could be exposed to direct sunlight for long periods of time.

Caution: To avoid any damage to the instrument or probes, do not exposed it to any sprays, liquids, or solvents.

Cleaning

Inspect the instrument and probes as often as operating conditions require.

To clean the instrument exterior, perform the following steps:

Wipe the dust from the instrument surface with a soft cloth. Take care not to scratch the transparent LCD protection screen when cleaning.

WARNING

! Before re applying power, ensure that the instrument is completely dry, avoiding any electric shock or electrical short circuit resulting from moisture.

Appendix C: USB Disk Requirements

USB disk requirements:

Max capacity 4G, NTFS file system is not supported.

If the USB disk doesn't work properly, format your USB disk and then try again.

Appendix D: PC Software Requirements

The PC software does not support Windows XP.

2021.03 V1.0.0